



No.F6/DFS/MS/School/NDZ/2023/ 800

Dated: 09/11/2023

FIRE SAFETY CERTIFICATE

Certified that the Oxford Modern Public School located at 1/4551-52, Ram Nagar Extn., Mandoli Road, Shahdara, Delhi-110032, now comprised of Ground + 03 upper floors only (Earlier it Ground + 01 upper floor only for which Fire Safety Certificate was issued by this department vide letter No. F6/DFS/MS/School/2018/NDZ/2029 dated 05.09.2018), have complied with fire prevention & fire safety requirements in accordance with 33 of the Delhi Fire Service Rules, 2010/ NBC Part - IV and verified by the officer concerned of Fire Service on 03.11.2023 in presence of Mr. Kuldeep Taygi (Manager) and that the building /premises is fit for occupancy class "Educational" (Group-B) with effect from 09/11/2023 for a period of three years in accordance with rule 36 unless renewal under rule 37 or sooner cancelled under rule 40 and subject to compliance of the conditions under rule 38 of the DFS rule 2010.

Issued on 09/11/2023 at New Delhi by.

(ATUL GARG)
DIRECTOR
DELHI FIRE SERVICE

Copy to:-

1. The Director of Education, EDMC, B- Block, Yamuna Vihar, Delhi.
2. The Manager, Oxford Modern Public School located at 1/4551-52, Ram Nagar Extn., Mandoli Road, Shahdara, Delhi-110032.

Conditions for the validity of Fire Safety Certificate

1. The owner /occupier shall apply for renewal of this fire safety certificate to the Director in form 'J' [sub rule(1) of rule 37] along with a copy of this certificate, six months prior to its expiry
2. All the means of escape shall be kept free of all the type of obstruction all the time.
3. All the employees shall be acquainted with the use and maintenance of all fire equipments and method of smooth and speedy safe evacuation of occupants in case of emergency.
4. All the fire fighting equipments shall be maintained in perfect working condition all the time and any lapse rendering non-functional of fire safety measures, management shall be responsible.
5. The clarification with regards electrical installation, ventilation, structure stability set back areas, occupancy and constructional deviation in building etc .may be got verified from the authorities concerned.
6. This Fire Safety Certificate cannot be treated in any case for regularizations of unauthorized construction unauthorized use of land if any.
7. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rule 2010. The form is available on www.dfs.delhigovt.nic.in.

- 298 -

INSPECTION REPORT

| 1 | Name & address of the building | Oxford Modern Public School located at 1/4551-52, Ram Nagar Extn., Mandoli Road, Shahdara, Delhi-110032. | | |
|------|--|--|-------------------|----------------|
| 2 | Building is comprised of | Ground + 03 upper floors only. ✓ | | |
| 3 | Type of occupancy | Educational Building | | |
| 4 | Type of case | New (Alteration/ Alteration) | | |
| 5 | Details of previous FSC | F6/DFS/MS/School/2018/NDZ/2029 dated 05.09.2018 (Ground + 01 only) | | |
| 6 | Fire safety directives letter no. | NBC Part -VI | | |
| 7 | Date of inspection | 03.11.2023 | | |
| 8 | Name of the inspecting officers | Yashwant Singh Meena ADO (L.N) | | |
| 9 | Name of the designation of officer from the building side | Mr. Kuldeep Taygi (Manager) | | |
| 10 | Year of construction | 1978 & 2022 | | |
| 11 | Applicant's letter no. | Outdoor Diary No. 8042 dated -31.10.2023 | | |
| S.No | Minimum standard of fire prevention and fire safety U/R 33 | NBC Part -IV requirement | Provided at site | Remarks MR/NMR |
| 1 | Access to Building: | | | |
| | A Road width | 6.0 mtrs. | 6.0 mtrs. ✓ | MR |
| | B Gate width | N/A | N/A | N/A |
| | C Width of internal road | N/A | N/A | N/A |
| 2 | Number, Width, Type and Arrangement of Exits: | | | |
| | A Number of staircases | | | |
| | a Upper floor | 02 no. | 02 nos. ✓ | MR |
| | b Basement | N/A | N/A | N/A |
| | B Width of staircases | | | |
| | a Upper floor | 1.50 mtrs. | 1.50 mtrs. each ✓ | MR (Old Case) |
| | b Basement | N/A | N/A | N/A |
| | C Protection of exits | | | |
| | a Fire check door | N/A | N/A | N/A |
| | b Pressurization | N/A | N/A | N/A |
| | D No. of continuous staircases to terrace | 02 nos. | 02 nos. ✓ | MR |
| | E Width of corridor | 1.50 mtrs. | 1.50 mtrs. ✓ | MR |
| | F Door size | 1.20 mtrs. | 1.20 mtrs. ✓ | MR |
| 3 | Compartmentation: | | | |
| | A Fire check door | NA | NA | NA |
| | B Sealing of electrical shafts | N/A | N/A | N/A |
| | C Fire rating of shaft door | N/A | N/A | N/A |
| | D Water curtain | N/A | N/A | N/A |
| | E Fire dampers | N/A | N/A | N/A |
| 4 | Smoke Management System: | | | |
| | A Basement | N/A | N/A | N/A |
| | B Upper floor | N/A | N/A | N/A |

(20)

- N/A -

| | | | | |
|----|--|--------------------------------|-----------------------|----------------------------|
| 5. | Fire Extinguisher: | | | |
| | A | Total numbers | 12 nos. | 12 nos. ✓ MR |
| | B | Types | CO ₂ & ABC | CO ₂ & ABC ✓ MR |
| | C | ISI marking | ISI Marked | Provided MR |
| 6 | First-Aid-Hose Reel: | | | |
| | A | Total numbers of each floor | 01 no. | 01 no. ✓ MR |
| | B | Length of hose reel hose | 30 mtrs. | 30 mtrs. ✓ MR |
| | C | Nozzle diameter | 05 mm | 05 mm ✓ MR |
| 7 | Automatic Fire Detection and Alarming System: | | | |
| | A | Type of detectors | N/A | N/A N/A |
| | B | Location of main panel | N/A | N/A N/A |
| | C | Location of repeater panel | N/A | N/A N/A |
| | D | Alternate source of power | N/A | N/A N/A |
| | E | Hooters | N/A | N/A N/A |
| 8 | MOEFA: | | N/A | Provided MR |
| 9 | Public Address System: | | N/A | Provided MR |
| 10 | Automatic Sprinkler System: | | | |
| | A | Basement | N/A | N/A N/A |
| | B | Upper floor | N/A | N/A N/A |
| | C | Sprinkler above false ceiling | N/A | N/A N/A |
| 11 | Internal Hydrants: | | | |
| | A | Size of riser/down-comer | N/A | N/A N/A |
| | B | Number of hydrants per floor | N/A | N/A N/A |
| | C | Hose box | N/A | N/A N/A |
| 12 | Yard Hydrants: | | | |
| | A | Total number of hydrants | N/A | N/A N/A |
| | B | Hose box | N/A | N/A N/A |
| 13 | Pumping Arrangements: | | | |
| 1 | Ground level | | | |
| | A | Discharge of main pump | N/A | N/A N/A |
| | B | Head of main pump | N/A | N/A N/A |
| | C | Number of main pumps | N/A | N/A N/A |
| | D | Jockey pump out put | N/A | N/A N/A |
| | E | Jockey pump head | N/A | N/A N/A |
| | F | Standby pump out put | N/A | N/A N/A |
| | G | Standby pump head | N/A | N/A N/A |
| | H | Auto starting /manual stopping | N/A | N/A N/A |
| | I | Pump house access | N/A | N/A N/A |
| 2 | Terrace Level | | | |
| | A | Discharge of pump | 450 LPM | 450 LPM ✓ MR |
| | B | Head of the pump | 40 mtrs. | 40 mtrs. ✓ MR |
| | C | Power supply | Required | Provided ✓ MR |
| | D | Auto starting of pump | Required | Provided ✓ MR |

Oxford Modern Public School located at 1/4551-52, Ram Nagar Extn., Mandoli Road, Shahdara, Delhi-110032.

W

| | | | | |
|-----------|---|-------------|----------------|----------|
| 14 | Captive Water Storage for Fire Fighting: | | | |
| A | Underground tank capacity | N/A | N/A | N/A |
| B | Draw-off connection | N/A | N/A | N/A |
| C | Fire service inlet | Required | Provided | MR |
| D | Access to tank | Required | Required | Required |
| E | Overhead tank capacity | 10,000 ltrs | 10,000 ltrs. ✓ | MR |
| 15 | Exit Signage: | Required | Provided | MR |
| 16 | Provision of Lifts: | | | |
| A | Pressurization of lift shaft | N/A | N/A | N/A |
| B | Pressurization of lift lobby | N/A | N/A | N/A |
| C | Communication in lift car | Required | Provided | MR |
| D | Firemen's grounding switch | Required | Provided | MR |
| E | Lift signage | Required | Provided | MR |
| 17 | Standby Power Supply: | Required | Provided | MR |
| 18 | Refuge Area: | | | |
| A | Total area | N/A | N/A | N/A |
| B | Location | N/A | N/A | N/A |
| 19 | Fire Control Room: | | | |
| A | Detector system panel | N/A | N/A | N/A |
| B | Flow switch panel | N/A | N/A | N/A |
| C | PA system panel | N/A | N/A | N/A |
| D | Battery backup | N/A | N/A | N/A |
| E | Building floor plans | N/A | N/A | N/A |
| 20 | Special Fire Protection systems for protection of special Risks, if any: | N/A | N/A | N/A |

The fire protection system was randomly checked and tested and was found functional at the time of inspection. The shortcomings issued vide letter no. F6/DFS/MS/School/2022/NDZ/51 dated 04.02.2022 by this department have been rectified by the management.

Keeping in view of the substantial compliance of the minimum standards on fire prevention and fire safety measures as required under the Rules, it is recommended to grant Fire Safety Certificate under Rules 37 of Delhi Fire Service Rules 2010.

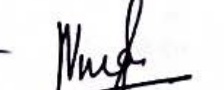

3/11/2023

Signature of the Inspecting Officer
Name- Yashwant Singh Meena
Designation- ADO (L.N)

DY.CFO/NDZ

C.F.O.


06/11/23


6/11/2023

Director


7/11/22


Ady Ln